


# Sick Bike Parts.com

## Throttle and cable installation instructions


1. Remove the clear cover from the top of the throttle housing.



2. Carefully remove the pulley. You can use a small allen wrench to rock it off of the pivot pin. Lift on one side and then the other until it slides off.

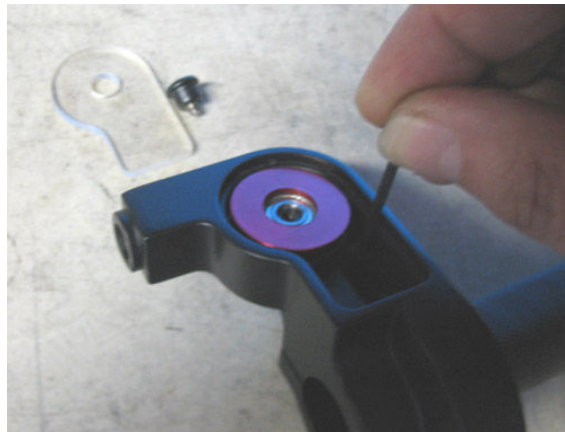

3. Remove the outer cover from the throttle housing. You may want to add some light lubricant where shown.

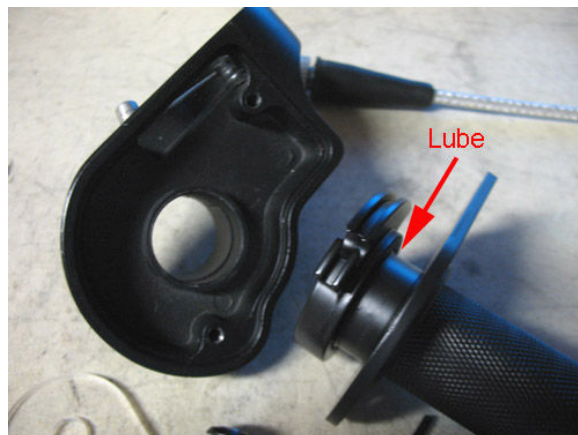

4. Insert the large cable end through the adjuster hole.



5. Insert the cable end into the slot on the throttle sleeve.



6. Attach the outer plate back onto the throttle housing.

7. Slide the cable into the slot on the pulley and place the pulley back onto the pivot pin.



8. Reinstall the clear cover back onto the throttle housing.



9. Screw the cable adjuster into the throttle housing.
10. Check your handle bars for any debris or burrs that could keep the throttle sleeve from rotating freely.
11. Apply some light oil to your bars and slide the throttle assembly on.
12. Adjust the throttle assembly onto your bars such that the throttle sleeve does not hit the end of your handle bars.
13. Secure the throttle assembly to your bars by tightening the clamp on the housing.
14. Route the throttle cable cleanly back to your carburetor ensuring there are no tight bends or kinks and attach to your carburetor.
15. Adjust the slack in the cable by using a combination of the adjuster at the throttle assembly and the carburetor. Ensure there is enough free play in the cable that the slide in the carburetor will seat properly onto the idle adjustment screw.